### DW **Carbon Steel & Low Alloy SAFETY DATA SHEET** 1 of 6

SECTION: 1 **IDENTIFICATION OF THE SUBSTANCE / MIXTURE AND OF THE COMPANY / UNDERTAKING** 1 1 Product Name: CARBON STEEL & LOW ALLOY WIRE Product Identification: EL12, EL8, EH14, EM11K, EM12K, ER70S-2, ER70S-3, ER70S-6, ER70S-7, ER70S-G, E70C-6, E70C-G, R45, R60, R65, EB2, EB3, EB6, EB8, EB9 Product Specification: AWS A5.2, A5.17, A5.18, A5.23 Relevant identified uses of the substance or mixture and uses advised against: 1.2 Relevant identified uses: For welding consumables and related products. 1.2.1 Uses advised: Reference the [7. Handling and storage] 1.2.2 Details of the supplier of the safety data sheet: 1.3 Supplier: Weld Wire Company, Inc. 103 Queens Drive King of Prussia, PA 19406 Emergency telephone number: (800) 523-1266 or (610) 265-3555 Email: info@weldwire.net SECTION: 2 HAZARDS IDENTIFICATION 2.1 Classification of the mixture: The product is placed on the market in solid form

#### Classification in accordance with GHS-US 2.1.1

STOT SE 3	H336
STOT SE 3	H335
STOT RE 1	H372

#### 2.2 Label elements:

**GHS-US** labeling

Hazard Pictograms (GHS-US):



Signal word (GHS-US): Danger

#### Hazard statements (GHS-US):

- H335 May cause respiratory irritation
- H336 May cause drowsiness or dizziness

H372 Causes damage to organs through prolonged or repeated exposure

#### Precautionary statements:

- P260 Do not breathe dust/fume/gas/mist/vapours/spray
- P261 Avoid breathing dust/fume/gas/mist/vapours/spray
- P264 Wash thoroughly after handling
- P270 Do not eat, drink or smoke when using this product.
- P271 Use only outdoors or in a well-ventilated area
- P304+P340 IF INHALED: Remove person to fresh air and keep comfortable for breathing
- P312 Call a POISON CENTER or doctor/physician if you feel unwell.
- P314 Get medical advice and attention if you feel unwell
- P403+P233 Store in a well ventilated place. Keep container tightly closed
- P405 Store locked up
- P501 Dispose of contents and container in accordance with local/regional/national/international regulations.
- 2.3 Other hazards: No additional information available
- Unknown acute toxicity (GHS-US): No data available. 2.4

SECTION:	3	COMPOSITION/INFORMATION ON INGREDIENTS	
3.1	Substances:	No data available	
	Full text	of H-phrases: see section 16	
3.2	Mixtures:	The mixture contains dangerous substances:	



# Carbon Steel & Low Alloy SAFETY DATA SHEET <sup>2 of 6</sup>

Substance name		Product Identifier (CAS No)	% Percent	GHS-US classification
Manganese	Mn	7439-96-5	0.05 - 2	Not classified
Silicon	Si	7440-21-3	0.1 - 1.15	Not classified
Copper	Cu	7440-50-8	0.3 - 0.5	Not classified
Carbon	C	7440-44-0	0.5 - 0.18	Not classified
Titanium	Ti	7440-32-6	0 - 0.17	Not classified
Aluminum	AI	7429-90-5	0 - 0.15	Not classified

#### SECTION: 4 FIRST AID MEASURES

#### 4.1 Description of first aid measures:

**First-aid measures after inhalation:** Remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

First-aid measures after skin contact: Flush with water for at least 15 minutes. Seek medical attention if irritation develops or persists.

First-aid measures after eye contact: Immediately flush eyes with water and continue washing for at least 15 minutes. Obtain medical attention if discomfort persists.

**First-aid measures after ingestion:** Do NOT induce vomiting. Get immediate medical attention.

#### 4.2 Most important symptoms and effects, both acute and delayed:

**Symptoms/injuries after inhalation:** Short-term (acute) overexposure to the gases, fumes, and dusts may include irritation of the eyes, lungs, nose, and throat. Some toxic gases associated with welding may cause pulmonary edema, asphyxiation, and death. Acute overexposure may include signs and symptoms such as watery eyes, nose and throat irritation, headache, dizziness, difficulty in breathing, frequent coughing, or chest pain. The presence of chromium/chromate in fume can cause irritation of nasal membranes and skin. The presence of nickel compounds in fume can cause metallic taste, nausea, tightness of chest, fever, and allergic reaction. Excessive inhalation or ingestion of manganese can produce manganese poisoning. Overexposure to manganese compounds may affect the central nervous system, symptoms of which are languor, sleepiness, muscular weakness, emotional disturbances, and spastic gait resembling Parkinsonism. These symptoms can become progressive and permanent if not treated. Excessive inhalation of fumes may cause "Metal Fume Fever" with Flu-like symptoms such as chills, fever, body aches, vomiting, sweating, etc.

Symptoms/injuries after skin contact:

- Symptoms/injuries after eye contact: Ca
- Dusts may cause irritation. Causes eye irritation.

Symptoms/injuries after ingestion: Not an anticipated route of exposure during normal product handling. May be harmful if ingested.

4.3 Indication of any immediate medical attention and special treatment needed: No data available.

SECTION:	N: 5 FIREFIGHTING MEASURES	
5.1	Extinguishing media:	
	Suitable extinguishing media: Use extinguishing media appr	priate for surrounding fire.
	Unsuitable extinguishing media: No data available.	
5.2	Special hazards arising from the substance or mixture: Fire ma	y produce irritating or poisonous gases.
	Fire hazard: Not flar	mable
	Explosion hazard: None k	own
5.3	Advice for firefighters: In the event of fire, wear self-contained bre	thing apparatus and full protective gear.
SECTION:	N: 6 ACCIDENTAL RELEASE MEASURES	
6.1	Personal precautions, protective equipment and emergency p	ocedures:
	For non-emergency personnel: Wear appropriate personal p For emergency responders: No data available.	otective equipment as specified in Section 8. Ensure adequate ventilation.
6.2	<b>Environmental precautions:</b> Avoid release into the environment. <i>A</i> water drains and sewers.	void dispersal of spilled material and contact with soil, ground and surface
6.3	Methods and material for containment and cleaning up: Take according to local and regional authority requirements.	p mechanically. Collect the material in labeled containers and dispose of

6.4 **Reference to other sections:** See Section 7 for information of safe handling. See Section 8 for information on personal protection equipment. See Section 13 for disposal information.

#### SECTION: 7 HANDLING AND STORAGE

7.1 **Precautions and safe handling:** Welding may produce dust, fumes and gases hazardous to health. Avoid breathing dust, fumes and gases. Use adequate ventilation. Keep away from sources of ignition. Avoid contact with skin, eyes and clothing. Do not eat, drink and smoke in work areas.



- 7.2 Conditions for safe storage, including and incompatibilities: Store in cool, dry and well-ventilated place. Keep away from incompatible materials. Keep away from heat and open flame.
- 7.3 Specific end use(s): For welding consumables and related products.

SECTION: 8 EX	POSURE CONTROLS / PERSONAL PROTECTION	
8.1 Control paramete	rs: Exposure limits were not established for this product	
Copper	(CAS No) 7440-50-8	
USA ACGIH	ACGIH TWA (mg/m³)	0.2 mg/m <sup>3</sup>
USA OSHA	OSHA PEL (TWA) (mg/m³)	1 mg/m <sup>3</sup>
Manganese	(CAS No) 7439-96-5	
USA ACGIH	ACGIH TWA (mg/m³)	0.1 mg/m <sup>3</sup>
USA OSHA	OSHA PEL (Ceiling) (mg/m³)	5 mg/m <sup>3</sup>
Silicon	(CAS No) 7440-21-3	
USA OSHA	OSHA PEL (TWA) (mg/m³)	5 mg/m <sup>3</sup>
Aluminum	(CAS No) 7429-90-5	
USA ACGIH	ACGIH TWA (mg/m³)	1 mg/m <sup>3</sup>
USA OSHA	OSHA PEL (TWA) (mg/m³)	5 mg/m <sup>3</sup>

#### 8.2 Exposure controls:

Appropriate engineering controls: Local exhaust and general ventilation must be adequate to meet exposure standards.

Hand protection: Wear welding gloves.

**Eye protection:** Wear helmet or face shield with filter lens of appropriate shade number. See ANSI/ASC Z49.1 Section 4.2. Provide protective screens and flash goggles, if necessary, to shield others.

**Skin and body protection:** Wear head and body protection, which help to prevent injury from radiation, sparks, flame and electrical shock. See ANSI Z49.1. At a minimum this includes welder's gloves and a protective face shield, and may include arm protectors, aprons, hats, shoulder protection, as well as dark substantial clothing. Train the employee not to touch live electrical parts and to insulate him/herself from work and ground. Welders should not wear short sleeve shirts or short pants.

**Respiratory protection:** If exposure limits are exceeded or irritation is experienced, NIOSH approved respiratory protection should be worn.

#### SECTION: 9

#### PHYSICAL AND CHEMICAL PROPERTIES

#### 9.1 Information on basic physical and chemical properties:

Physical state:	- Solid
Appearances:	- Rods or wire
Color:	- Metallic
Odor:	- No data available
Odor threshold:	- No data available
pH:	- No data available
Relative evaporation rate (butylacetate=1):	- No data available
Melting point:	- No data available
Freezing point:	- No data available
Initial boiling point and boiling range:	- No data available
Flash point:	- No data available
Self ignition temperature:	- No data available
Decomposition temperature:	- No data available
Flammability (solid, gas):	- No data available
Vapour pressure:	- No data available
Relative vapour density at 20° C:	- No data available
Relative density:	- No data available
Solubility(ies)	- No data available
Log Pow:	- No data available



## Carbon Steel & Low Alloy SAFETY DATA SHEET 4 of 6

Log Kow:	- No data available
Viscosity, kinematic:	- No data available
Viscosity, dynamic:	- No data available
Explosive properties:	- No data available
Oxidizing properties:	- No data available
Explosive limits:	- No data available

**9.2 Other information:** No additional information available.

#### SECTION: 10 STABILITY AND REACTIVITY

- 10.1 Reactivity: No additional information available.
- 10.2 Chemical stability: The product is stable under normal conditions. When using it may produce dangerous fumes and gases.
- 10.3 Possibility of hazardous reactions: Will not occur.
- 10.4 Conditions to avoid: None
- 10.5 Incompatible materials: None
- **10.6 Hazardous decomposition products:** Welding fumes and gases cannot be classified simply. The composition and quantity of both are dependent upon the metal being welded, the process, procedure and welding consumables used. Other conditions which also influence the composition and quantity of the fumes and gases to which workers may be exposed include: coating on the metal being welded (i.e. paint, painting, galvanizing), the number of welders, the volume of the work area, the quality and the amount of ventilation, the position of the welders head with respect to the fume plume, as well as the presence of contaminants in the atmosphere (such as chlorinated hydrocarbon vapors from the cleaning and degreasing activities).

When an electrode is consumed, the fume and gas decomposition products generated are different in percent and form from the ingredients listed in Section 3. Fume and gas decomposition, and not the ingredients in the electrode, are important. The concentration of a given fume or gas component may decrease or increase by many times the original concentration. Also, new compounds not in the electrodes may form. Decomposition products of normal operation include those originating from the volatilization, reaction or oxidation of the materials shown in Section 3, plus those from the base metal coating, etc., as noted above. Reasonable expected fume constituents of this product would include: Complex oxides of iron, manganese, silicon, chromium, nickel, columbium, molybdenum, copper, carbon dioxide, carbon monoxide, ozone and nitrogen oxides. Some products will also contain antimony, barium, molybdenum, aluminum, columbium, magnesium, strontium, tungsten, and or zirconium. Fume limit for chromium, nickel and or manganese may be reached before limit of 5 mg/m3 of general welding fumes is reached.

Gaseous reaction products may include carbon monoxide and carbon dioxide. Ozone and nitrogen oxides may be formed by the radiation from the arc. Determine the composition and quantity of fumes and gases to which workers are exposed by taking an air sample from inside the welder's helmet if worn or in the worker's breathing zone. Improve ventilation if exposures are not below limits. See ANSI/AWS F1.1, F1.3 and F1.5, available from the American Welding Society, 550 N.W. LeJeune Road, Miami, FL 33126.

#### SECTION: 11 TOXICOLOGICAL INFORMATION

#### 11.1 Information on toxicological effects:

#### Acute toxicity: Harmful if swallowed

Substance name	CAS number	LD50 oral rat	(mg/kg)	ATE (oral)	(mg/kg)	Comments	
Manganese	7439-96-5			9000000.0	00 mg/kg		
Silicon	7440-21-3			3160.0	00 mg/kg		
Carbon	7440-44-0	> 10000	mg/kg				
Skin corrosion/irritation:		Not classified					
Serious eye damage/irritation:	Not classified	Not classified					
Respiratory or skin sensitisation:	Not classified						
Germ cell mutagenicity:	Not classified	ot classified					
Carcinogenicity:	Not classified						
Reproductive toxicity:	Not classified	Not classified					
Specific target organ toxicity (sir	May cause drowsi	May cause drowsiness or dizziness. May cause respiratory irritation.					
Specific target organ toxicity (re	Specific target organ toxicity (repeated exposure):			Causes damage to organs through prolonged or repeated exposure.			
Aspiration hazard:		Not classified					
SECTION: 12 ECOL	OGICAL INFORMATIO	ON					

12.1 Toxicity:

Ecology - general: No additional information available.



## Carbon Steel & Low Alloy SAFETY DATA SHEET 5 of 6

Copper	(CAS No) 7440-50-8		
LC50 fishes 1	0.0068 - 0.0156 mg/l (Exposure time: 96 h - Species: Pimephales promelas)		
EC50 Daphnia 1	.03 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])		
EC50 other aquatic organisms 1	0.0426 - 0.0535 mg/l (Exposure time: 72 h - Species: Pseudokirchneriella subcapitata [static])		
LC50 fish 2	< 0.3 mg/l (Exposure time: 96 h - Species: Pimephales promelas [static])		
EC50 other aquatic organisms 2	0.031 - 0.054 mg/l (Exposure time: 96 h - Species: Pseudokirchneriella subcapitata [static])		

12.2 Persistence and degradability: No additional information available.

- **12.3** Bioaccumulative potential: No additional information available.
- **12.4** Mobility in soil: No additional information available.
- **12.5** Other adverse effects: No additional information available.

#### SECTION: 13 DISPOSAL CONSIDERATIONS

13.1 Waste treatment methods: Dispose of in accordance with local and national regulations.

Waste disposal recommendations: Dispose of contents/container in accordance with local/regional/national/international regulations.

#### SECTION: 14 TRANSPORT INFORMATION

#### In accordance with DOT / ADR / RID / ADNR / IMDG / ICAO / IATA

- 14.1 UN Number: Not a dangerous good in sense of transport regulations
- 14.2 UN proper shipping name: Not applicable

#### SECTION: 15 REGULATORY INFORMATION

#### 15.1 US Federal Regulations:

15:1 65164614	nogulationel	
Copper	(CAS No)	7440-50-8
Listed on the United States Listed on SARA Section 313		
SARA Section 313 - Emission	on Reporting	1.0%
Manganese	(CAS No)	7439-96-5
Listed on the United States Listed on SARA Section 313		
SARA Section 313 - Emission	on Reporting	1.0%
Silicon	(CAS No)	7440-21-3
Listed on the United States	S TSCA (Toxic Substances	S Control Act) inventory
Titanium	(CAS No)	7440-32-6
Listed on the United States	S TSCA (Toxic Substances	S Control Act) inventory
Carbon	(CAS No)	7440-44-0
Listed on the United States	S TSCA (Toxic Substances	S Control Act) inventory
Aluminum	(CAS No)	7429-90-5
Listed on the United States Listed on SARA Section 313		
SARA Section 313 - Emission	on Reporting	1.0 % (dust or fume only)

#### 15.2 US State Regulations:

Copper	(CAS No)	7440-50-8			
U.S Massachusetts - Right T	o Know List				
U.S Minnesota - Hazardous	U.S Minnesota - Hazardous Substance List				
U.S New Jersey - Right to Know Hazardous Substance List					
U.S Pennsylvania - RTK (Rig	ht to Know) List				



# Carbon Steel & Low Alloy SAFETY DATA SHEET 6 of 6

#### <u>Manganese</u>

Silicon

### (CAS No) 7439-96-5

U.S. - Massachusetts - Right To Know List

U.S. - Minnesota - Hazardous Substance List

U.S. - New Jersey - Right to Know Hazardous Substance List

U.S. - Pennsylvania - RTK (Right to Know) List

#### (CAS No) 7440-21-3

U.S. - Massachusetts - Right To Know List

U.S. - Minnesota - Hazardous Substance List

U.S. - New Jersey - Right to Know Hazardous Substance List

U.S. - Pennsylvania - RTK (Right to Know) List

### Titanium (CAS No) 7440-32-6

### U.S. - New Jersey - Right to Know Hazardous Substance List

#### Aluminum

(CAS No) 7429-90-5

Aluminum

U.S. - Massachusetts - Right To Know List U.S. - Minnesota - Hazardous Substance List

U.S. - New Jersey - Right to Know Hazardous Substance List

U.S. - Pennsylvania - RTK (Right to Know) List

### SECTION: 16

#### OTHER INFORMATION

#### Full text of H-phrases:

_		
STOT RE 1	Specific target organ toxicity — Repeated exposure, Category 1	
STOT SE 3	Specific target organ toxicity — Single exposure, Category 3,	Narcosis
STOT SE 3	Specific target organ toxicity — Single exposure, Category 3,	Respiratory tract irritation
H335	May cause respiratory irritation	
H336	May cause drowsiness or dizziness	
H372	Causes damage to organs through prolonged or repeated exposure	


NFPA health hazard:

NFPA fire hazard:

NFPA reactivity:

1 - Exposure could cause irritation but only minor residual injury even if no treatment is given.

- 0 Materials that will not burn.
- 0 Normally stable, even under fire exposure conditions, and are not reactive with water.

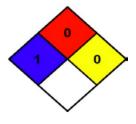

#### HMIS III Rating

5	
Health:	2 Moderate Hazard - Temporary or minor injury may occur
Flammability:	0 Minimal Hazard
Physical:	0 Minimal Hazard

We believe that the information contained herein is believed to be true and accurate as of the date of this SDS. All statements or suggestions are made without any warranty, expressed or implied, regarding the accuracy of the information, the hazard connected with the use of this material or the results to be obtained for use thereof. As the condition or methods of use are beyond our control, we do not assume any responsibility and expressly disclaim any liability for any use of this material. It is the user's obligation to determine the conditions of safe use of these products.

All chemical products can in fact present unknown risks to health, safety and / or the environment, even in relation to the different operating conditions, and they must therefore be used with care. For this reason we cannot guarantee that the risk described in this form are the only foreseeable risks. The user must therefore satisfy himself as to the particular conditions under which it is intended to be use in. Moreover, it must be noted that the user is obliged to comply with all the legislative, administrative and regulatory provisions regarding the product and its use in terms of occupational hygiene and safety, and environmental protection, apart from the information given in the form, given purely as guidance.

**Technical Department**